


Mounting Instruction for 90-FM-56-CX3 7.0 QM

Item no. 99909597


Step: 1

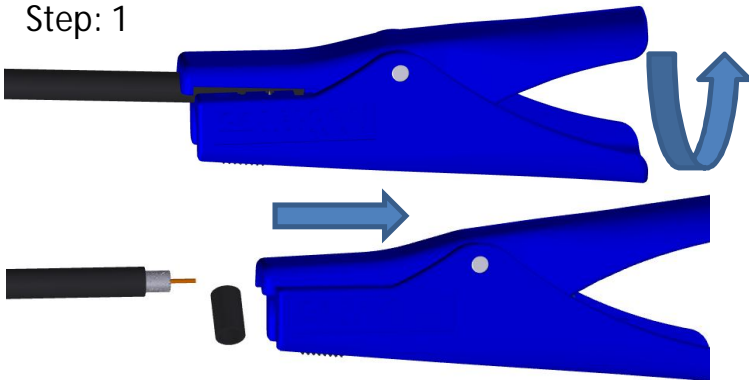

Step: 1

We strongly recommend the use of Corning Cabelcon's pre-adjusted WB Rotary Cable Stripper Item no. 98501080 for oversize PE cables and Item no. 98501083 for indoor/PE standard cables for proper preparation of cable. Please read the enclosed user instruction before using the tool. After stripping, the prepared cable dimension should be as follows:

Step: 2

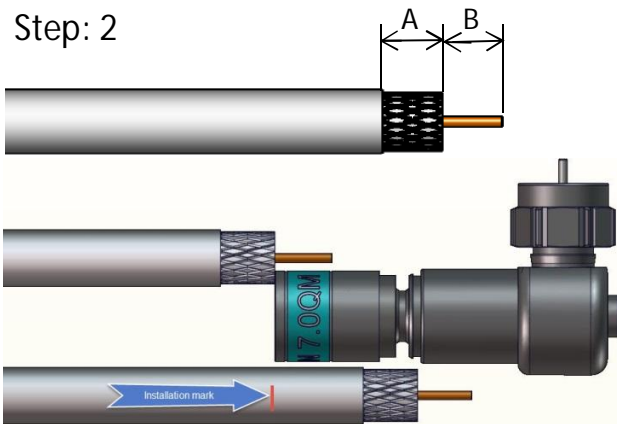


Step: 2

A = 6,5mm (outer conductor) Leave only the first layer of braid
B = 6,5mm (inner conductor)

You can use the cutting guide on the connector Body (label) to check for proper stripping dimensions.

You can use connector for making an installation mark (do not use knife) to identify correct installation distance.

Step: 3

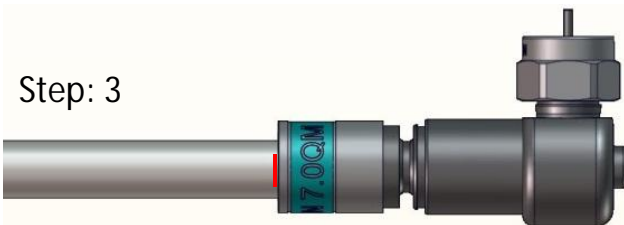

If necessary, clean the cable inner conductor with a conductor cleaner item no. 98500903 and the outer conductor with appropriate equipment.

Step: 3

Push the connector over the cable and allow braid to slide into the front of the connector, back of the connector has to be flush with the installation mark. Notes; Do not bend the braid back

Step: 4



Step 4:

Compress the connector by using the recommended compression tool, see tools and accessories below

Rev. Date: 30/01-2017

Tools and Accessories (use link for full tool list)	Item No.
CABLE STRIPPER I/D RG6/59 WB FOR INDOOR PVC CABLE	98501083
CABLE STRIPPER O/D RG6/59 WB FOR OUTDOOR PE CABLE	98501080
CABLE CUTTER DROP RG59/6/11 CCS	98028619-01
CONDUCTOR CLEANER CC-200EUR	98500903
TORQUE WRENCH AH HEX 11mm 4,5NM	98029080-01
COMPRESSION TOOL CX3 RG59/6 WB Wall box compression tool	98029046
COLOR MARKING CX3. BLACK/BROWN/RED/ORANGE/YELLOW/GREEN/BLUE/VIOLET/GREY/WHITE/TURQUIS	990040**

© 2017 Corning Incorporated. All Rights Reserved.

ISO 9001 certified

CORNING

Corning Optical Communications ApS,
Industriparken 10, DK-4760 Vordingborg
Tel: +45 55 98 55 99 Fax: +45 55 98 55 04
E-mail: cabelcon@corning.com www.cabelcon.dk